

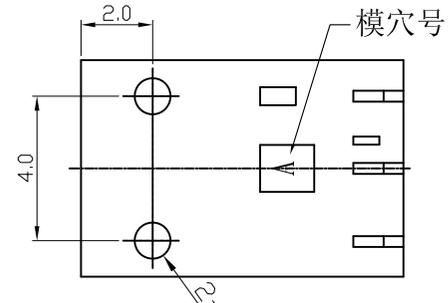
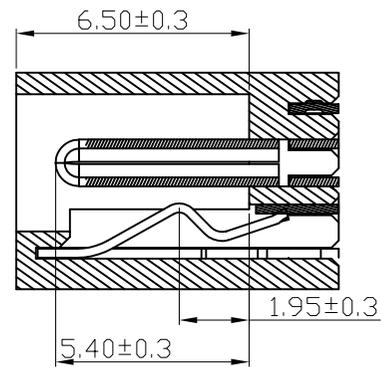
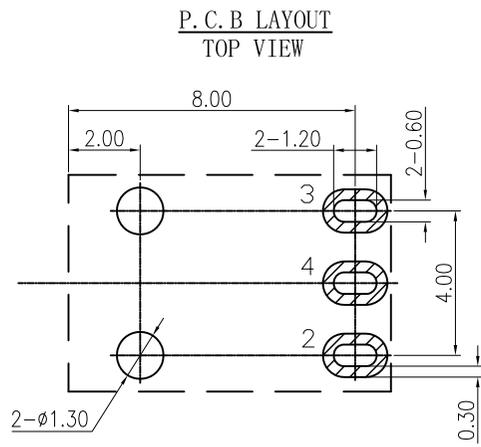
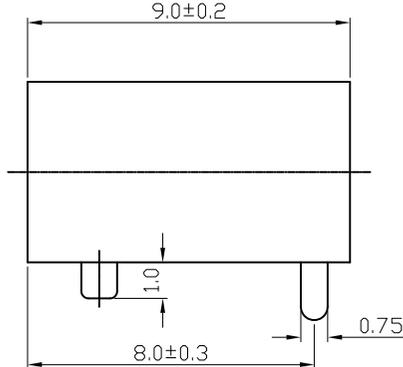


环保物料


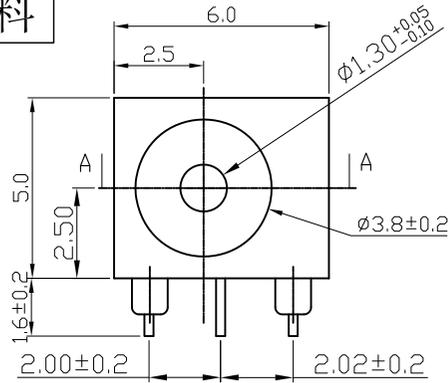


SCHEMATIC

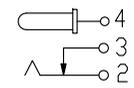


SPECIFICATION

1. Rating : DC 12V 2.5A;
2. Contact resistance:  $\leq 0.03 \Omega$ ;
3. Insulation resistance:  $\geq 100M \Omega$  (DC250V);
4. Withstand voltage: 500VAC ;
5. Insertion and extraction force: 3-20N;
6. life test: 5,000 cycles.

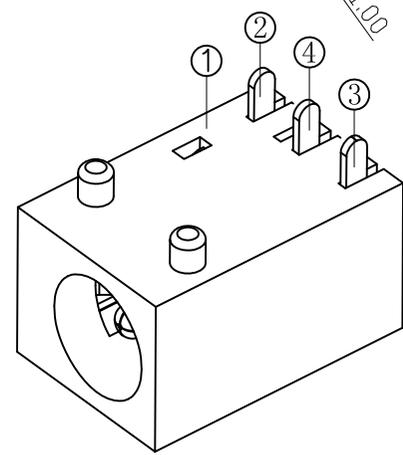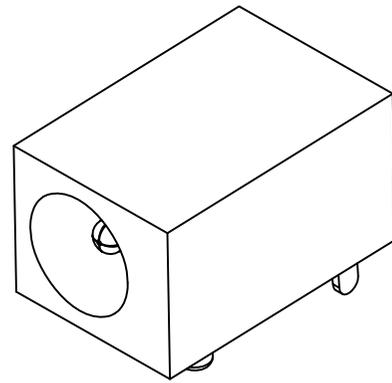

4	PIN	1	BRASS	Ag-Plating
3	CURVE PIECE	1	BRASS	Ag-Plating
2	SPRING	1	BRONZE	Ag-Plating
1	HOUSING	1	PA9T	
NO.	DESCRIPTION	QTY	MATERIAL	PLATING

					一般公差 GENERAL TOLERANCE		绘图 DR.	李兴泽	料号 PART NO.		文件编号 NUMBER		 TERMINAL&CONNECTORS	
					X.X ±0.30	X* ±2*	校对 CHK.	董东平	W-DC-H500-012		ENDPT01			
					X.XX ±0.20	X.X* ±1*	审核 CHK.	董东平	品名 TITLE		比例 SCALE		SHEET	版次 REV.
					X.XXX ±0.10	▲ MAJOR DIM.	核准 APPD.	杨章雄	Φ 3.5 H5.0 卧式DIP DC POWER JACK		1/1		1/1	A1
版次 REV.	日期 DATE	变更内容 DESCRIPTION	审核 CHK.	核准 APPD.	单位 UNIT	mm	核准 APPD.							

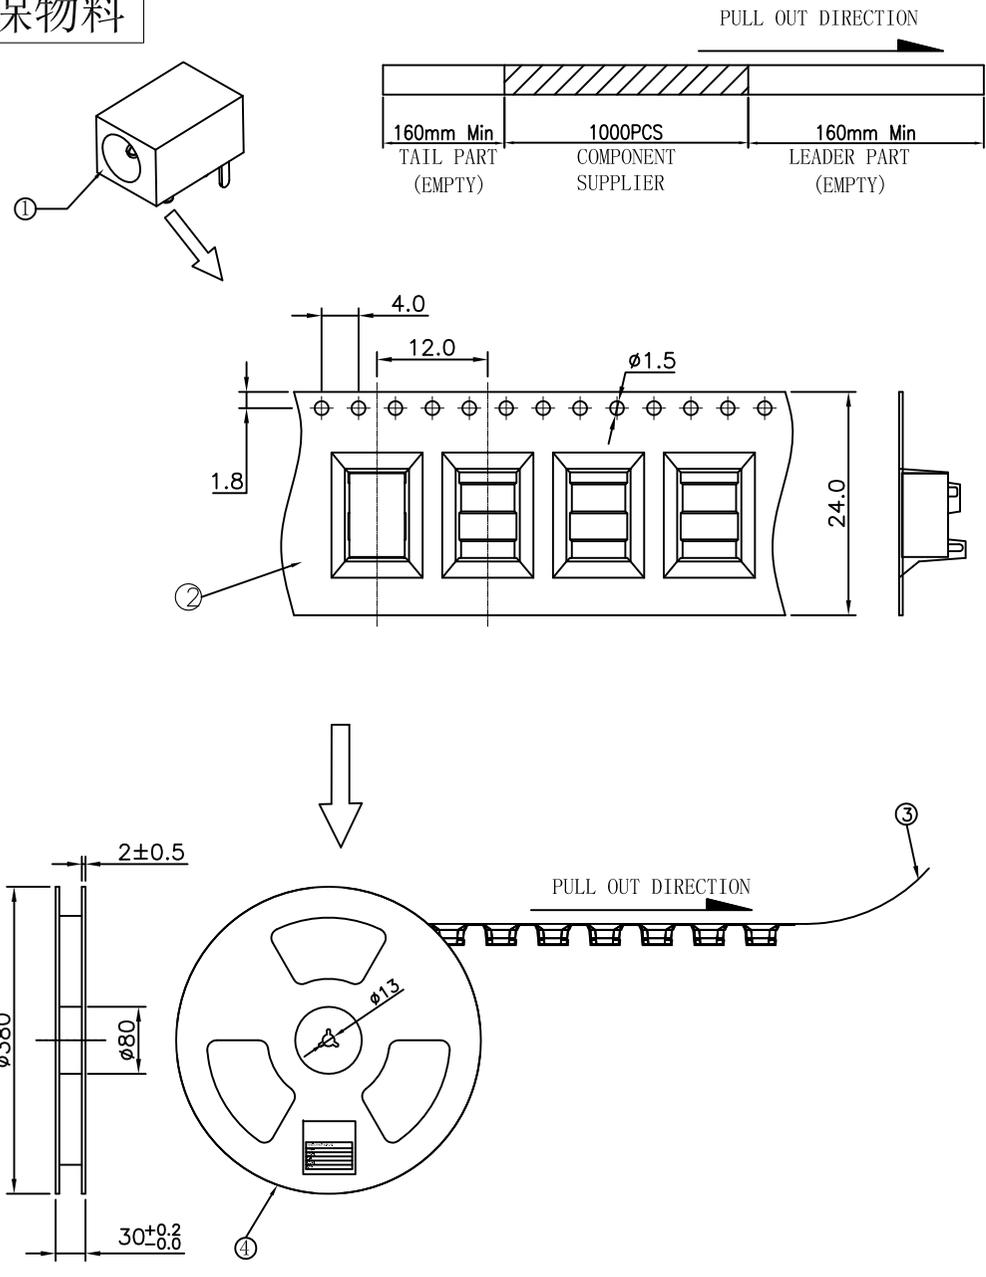

1. 包装方式:

- 1.1. 使用半自动包装机, 先将CARRY TAPE 送入导轨中, 并与COVER TAPE 贴合在上面, 其中初始160mm Min空槽不要放产品, 然后将产品如图所示方向依次放入CARRY TAPE内, 每个槽放1PCS, 每REEL共包装产品1000PCS, 最后需留160mm Min空槽不放产品.
- 1.2. 用胶带将CARRY TAPE粘在一起, 外圈再用塑胶带(电周波)缠绕一圈, 按客户要求贴在REEL上贴上LABEL, 注明料号, 日期, 数量.
- 1.3. 如图示, 将装好的REEL装入PE袋内, 再将其放入CARTON内, 最后用胶带封箱, 并在纸箱外相应的地方贴上标签.


注意:

1. 防止漏装, 禁止碰歪产品锡脚;
2. 产品在 CARRY TAPE中的方向须如图示(BOSS的方向)

2. 包装数量:

1000pcs/REEL  
10REEL(10000PCS)/CARTON

3. 单重:

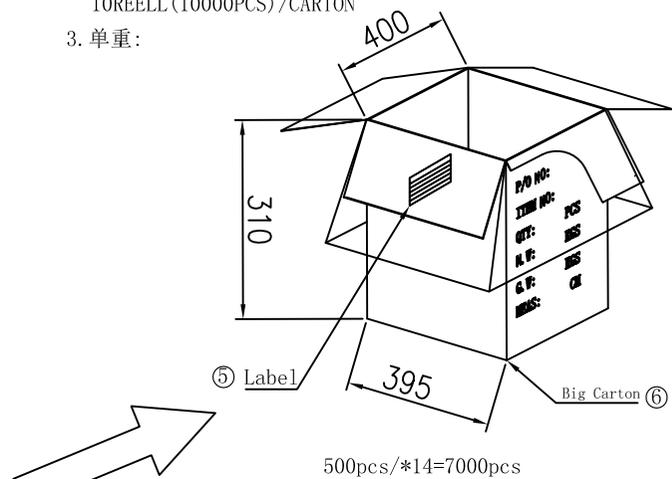

⑥	CARTON	395*395*310 (INNER DIM.)
⑤	LABEL (标签)	
④	REEL	□380mm, H=30mm
③	COVER TAPE	PE, W=21.5mm
②	CARRY TAPE	PET, W=24mm, P=12mm, L=12.3M
①	DC-JACK	W-DC-H500-012

					一般公差 GENERAL TOLERANCE		绘图 DR.		料号 PART NO.		文件编号 NUMBER	
					X.X ±0.30	X* ±2*	校对 CHK.		W-DC-H500-012		ENDPT01	
					X.XX ±0.20	X.X* ±1*	审核 CHK.		品名 TITLE		比例 SCALE	
					X.XXX ±0.10	▲ MAJOR DIM.	核准 APPD.		Φ3.5板上型 H=5.0 DC POWER JACK-包装图		1/1	SHEET 1/1
版次REV.		日期 DATE	变更内容 DESCRIPTION		审核 CHK.	核准 APPD.	单位 UNIT	mm	核 准	核 准	APPD.	版次 REV.

<b>JGTC</b> ®		
TERMINAL&CONNECTORS		
1/1	1/1	A1