








Soldertails; 60u" Min. Nickel Underplating Over All.

Operating Temperature: $-55^{\circ}\text{C}\sim+105^{\circ}\text{C}$




RECOMMENDED PCB LAYOUT (TOP VIEW)
THICKNESS IS 2.60mm; DIMENSION TOLERANCE: $\pm 0.05\text{mm}$





RECOMMENDED EDGE CARD LAYOUT (TOP VIEW)
THICKNESS IS 1.57±0.13mm; DIMENSION TOLERANCE: ±0.05mm

REV.	REVISION RECORD	DATE		GENERAL TOLERANCES		SCALE 1:1	NAME	DATE	PART NO.	DWG NO.				
X0	Initial release	26.03.26		LINEAR	ANGLES	APPROVED			22502W9-250A-0HT11	ENDE05				
				0.0±0.30	X° REF±6°									
			UNIT: MM	0.00±0.20	X° ±3°	DESIGNER			TITLE POWER CARD EDGE FEMALE R/A DIP					
			SIZE: A4	0.000±0.08	X° X' ±2°	DRAWN	Micky Ma	26.03.26						
											REV	X0	SHEET	1/2

RoHS 2.0+HF




产品

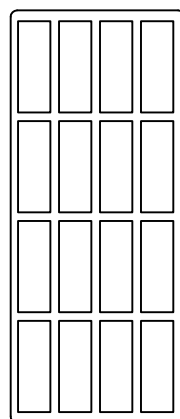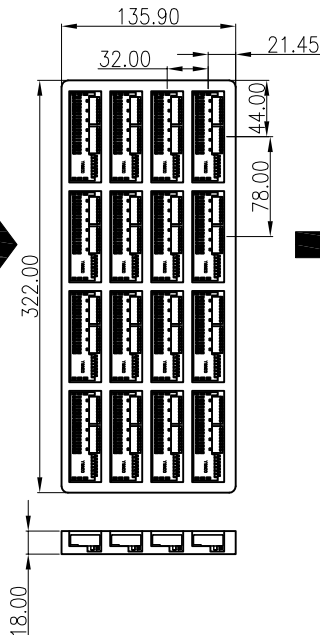


最上层合上空盒


黑色

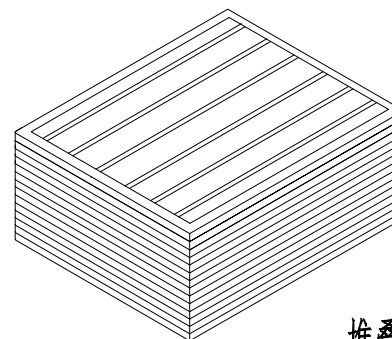

堆叠12盒用PE膜缠绕四周

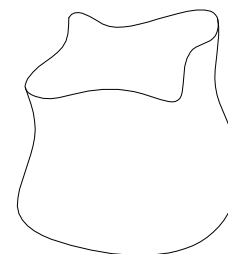

将缠好的真空盒放入PE袋中

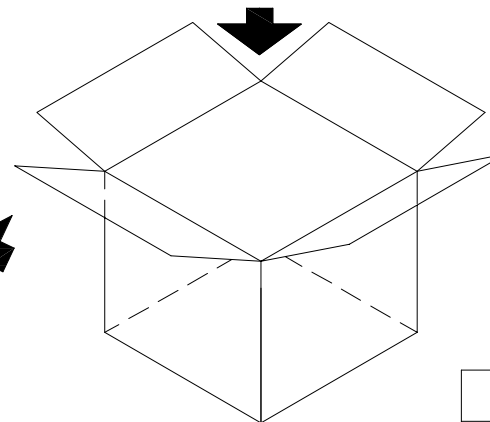

将PE袋放入纸箱内


包装说明:

步骤一: 将验好之产品方向一致脚朝下摆入真空盒内.

步骤二: 摆好产品后, 盖上空盖, 堆叠12盘用PE膜缠绕四周, 并贴上标签, 同步自检一遍, 确认是否有漏检, 少数等异常.

步骤三: 将缠好的真空盘装入PE袋中, 将装好产品的PE袋放入纸箱内.

步骤四: 放完PE袋后, 再用胶纸将纸箱封箱固定包扎, 并贴上标签.

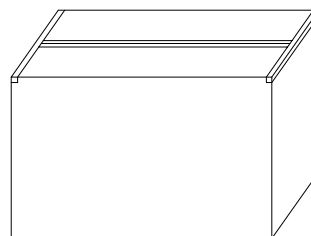

每盘数量	16pcs
每箱数量	192pcs

REV.	REVISION RECORD	DATE		GENERAL TOLERANCES		SCALE 1:1	NAME	DATE	PART NO.	DWG NO.	JCTC®			
X0	Initial release	26.03.26		LINEAR	ANGLES	APPROVED			22502W9-250A-OHT11	ENDE05				
				0.0±0.30	X° REF±6°									
				UNIT: MM	0.00±0.20	X° ±3°	DESIGNER		TITLE POWER CARD EDGE FEMALE R/A DIP					
			SIZE: A4	0.000±0.08	X° X' ±2°	DRAWN	Micky Ma	26.03.26						
											REV	X0	SHEET	2/2